

CONSTRUCTION INDUSTRY COUNCIL 建造業議會

CIC Safety Message No. 01 / 25

ELEVEN WORKERS INJURED AFTER A BAMBOO SCAFFOLD COLLAPSED AT A CONSTRUCTION SITE IN KAI TAK

On 13 January 2025, an accident happened at a construction site in Kai Tak, in which a bamboo scaffold mounted on the external wall of a building, where curtain wall installation works were undergone, suddenly collapsed, leaving eleven workers injured. The Construction Industry Council (CIC) would like to deliver this safety message for your attention. It would be appreciated if you could distribute the message below to your fellow members, relevant personnel or other industry stakeholders where appropriate. Thank you very much.

Common Accidents

- Failure to strictly follow the requirements as stipulated in the "Code of Practice for Bamboo Scaffolding Safety" published by the Labour Department and install sufficient critical members (e.g. ties).
- 2. Alter the bamboo scaffold without the immediate supervision of a competent person.
- 3. Insufficient management and barricades to the fatal zones.
- Failure to conduct dynamic risk assessments and take appropriate safety measures in response to changes in the environment and working procedures.

Конструкций Составности Составности

Critical Control Measures

- 1. Prior to the commencement of works, construction team should conduct risk assessments by taking the nature of work and the working environment into consideration; and formulate the safe working procedures.
- 2. Bamboo scaffolds should be properly designed by professional engineers, besides, bamboo scaffolds should be erected, altered and dismantled by trained workmen under the immediate supervision of the competent person.
- 3. Bamboo scaffolds should be inspected by competent person before being taken into use for the first time, at regular intervals not exceeding 14 days immediately preceding each use of the scaffold, and after any exposure to weather conditions likely to have affected its strength or stability or to have displaced any part; The competent person should also sign and issue "Form 5" to ensure that the scaffold is in safe working order.
- 4. Strictly follow the requirements as stipulated in the "Code of Practice for Bamboo Scaffolding Safety" published by the Labour Department, to install sufficient scaffolding members and critical members, including standards, ledgers, bracings and ties, and they should be complied with relevant standard.
- 5. Ensure the supporting structures are justified with sufficient stability, and the structural anchors for the ties are preset into the structurally sound members of building. Consider painting bright colours and affixing warning signs to the ties to alert workers.
- 6. Do not make unauthorised alteration to the bamboo scaffolds and do not work on the unchecked bamboo scaffolds.
- 7. Strictly prohibit any workers from entering the fatal zone where risks of falling objects are foreseeable by, for example, cordoning or fencing off the areas.
- 8. Establish and implement an effective monitoring and management system to ensure all safety measures are strictly followed.







SAFETY ROLES AND RESPONSIBILITIES OF KEY STAKEHOLDERS IN THE HONG KONG CONSTRUCTION INDUSTRY


What if all stakeholders can act together and take one step further to fulfill their roles and responsibilities, can similar accident be avoided?

- In the design stage, designers and engineers should take into accounts the nature of work and the work environment prior to the commencement of works; and adopt appropriate working platforms and construction methods.
- During the construction stage, the construction team should develop, implement and maintain a safety
 management system for bamboo scaffolds, and arrange competent person and allow sufficient time for
 them to check the stability of bamboo scaffolds before use, in order to ensure the secureness of the main
 posts and the ties are remain secured in positions.
- The work team should ensure that workers are only allowed to work on the bamboo scaffolds unless a competent person has inspected the bamboo scaffolds and confirmed that they are in safe working order.
- Workers should follow the developed safe working procedures, in case identifying any risks of falling from height, report it to their supervisors immediately.

Reference information for sharing



Guidelines on Planking Arrangement for Providing Working Platforms on Bamboo Scaffolds

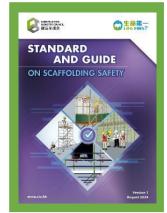

Standard and Guide on Scaffolding Safety



Reference Material on Safety Roles

and Responsibilities of Key

Stakeholders in the Hong Kong

Construction Industry (Practical Reference Guidance On Erection and



Work-At-Height Safety Handbook





Disclaimer

This message is not intended to constitute any professional advice on these or any other subjects. The CIC (including its members and employees) will not accept responsibility for any consequences resulting from the use of or failure to use this message. For enquiries, please contact 2100 9000.